



DATA EAST PINBALL, INC.

SERVICE BULLETIN

May 12, 1988

Game: Secret Service

#008

Subject: Correction to Service Bulletin #003

In Service Bulletin #003 dated April 20, 1988, we discovered an error. The capacitor that needs to be changed is not C-6. The capacitor that needs to be changed is C-66. The corrected bulletin text follows:

**Symptom:** Upon initial power up of the game, the game will play properly but it will have no sound. Turning the game off and back on will bring the sound back.

**Problem:** The Motorola CPU chip at board location D/E-8 is coming out of reset ahead of the Yamaha 2151 sound chip at board location C-66.

**Solution:** In the reset circuit, replace the 10 microfarad capacitor at C-66 with a 47 microfarad 16 volt electrolytic capacitor. This will lengthen the reset time to the CPU chip so that both the CPU and the sound chip come out of reset together.

Pete Gustafson  
Field Service Manager  
Data East Pinball, Inc.